

Work Order ID 74971

Thursday, October 13, 2011 2:35:31 PM

74971

Page 1

Get 21st or sooner

Item ID: DSI 9268-011

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Basket Modification

Stop

NS2

Start Date: 10/13/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/13/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: *mf*

Date: *11-10-13*

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
DSI 9268	Rev C

100	DOCUMENT CONTROL	0.00							
100									
DC	Memo	0.00							
Document Control	Photocopy bluefile & type labels per PPP DSI 9268-011 CHG 003								

S u l c o l e s

for MJS 11-10-13

110	Pick Kit	0.00							
110									
Packaging	Memo	0.00							
Packaging									

11/10/13

120	QC4- 100% Inspect kits for completeness	0.00							
120									
QC	Memo	0.00							
Quality Control									

S u l c o l e s

(X)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

H:\FORMS\Quality Assurance\approved QAINCRWO RevE

Work Order ID 74971

Thursday, October 13, 2011 2:35:31 PM

74971

Page 2

Item ID: DSI 9268-011

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Basket Modification

Stop ***NS2***

Start Date: 10/13/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/13/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130		0.00							
130									
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP DSI 9268-011								
	Location: _____								
	PPP rev: _____								
140	QC21- Final Inspection - Work Order Release	0.00							
140									
QC	Memo	0.00							
Quality Control									

11/10/18

11-10-18

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, October 13, 2011 2:35:30 PM

Page 1

Work Order ID: 74971

Parent Item: DSI 9268-011

Parent Item Name: Basket Modification

Start Date: 10/13/2011

Required Date: 10/13/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:D 09-02-25 rev.c as per dwg DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN4-17A Bolt		Purchased	No			110	Each	741.0000	5	5			

Location	Loc Qty	Loc Code
ST358	141	
116419	0	
116704	0	
117514	41	
117619	100	
ST359	600	
118628	300	
118983	300	

AN960JD416 Washer	NAS1149D0463J	Purchased	No			110	Each	0.0000	5	5			
D3230-041 Basket Wedge Assembly		Manufactured	No			110	Each	0.0000	1	1			
DSI 9053-011 Basket Hinge Change		Manufactured	No			110	Each	4.0000	1	1			

Location	Loc Qty	Loc Code
MEZZ	4	
26658	2	
35680	2	

Handwritten notes and signatures:

- 5
- 11/18/12
- 74972
- 11/10/12
- 1
- 11/10/12
- 1

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, October 13, 2011 2:35:30 PM

Page 2

Work Order ID: 74971

Parent Item: DSI 9268-011

Parent Item Name: Basket Modification

Start Date: 10/13/2011

Required Date: 10/13/2011

Start Qty: 1.00

Required Qty: 1.00

MS21042L4

Nut

Purchased

No

110

Each

14,231.000

5 11/10/11 5

Location

Loc Qty

Loc Code

ST300

3231

117441

51

117601

557

117885

56

118451

1567

118927

1000

ST516

6000

119017

6000

ST518

5000

119075

5000

Thursday, October 13, 2011 2:35:30 PM

Shop Packet Print

Page 2

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART SERVICE INSTRUCTION REFERENCE ONLY

TO AMEND INSTALLATION INSTRUCTIONS D205-541

REF. CANADIAN STC: SH96-120

REF. FAA STC: SR00696NY

EASA STC: EASA.IM.R.S.0.1242

THE PURPOSE OF THE DSI 9268-011 BASKET MODIFICATION KIT IS TO INCREASE THE VOLUME OF THE D205-541-043/-044 BASKETS. NOTE THAT D205-541-041 BASKETS MUST BE CONVERTED INTO D205-541-043/-044 PER DSI 9226 BEFORE PERFORMING THIS MODIFICATION.

TO INSTALL THE DSI 9268-011 KIT:

- 1) FOR BASKETS WITH:
- A) PIANO HINGES: INSTALL THE DSI 9053-011 HINGE CHANGE KIT AND SEPARATE LID FROM BASE.
OR
 - B) DSI 9053-011 HINGE CHANGE KIT ALREADY INSTALLED: NO CHANGE IS REQUIRED. SEPARATE LID FROM BASE.
OR
 - C) HINGE PLATES WELDED TO LID & BASE: NO CHANGE IS REQUIRED. SEPARATE LID FROM BASE.
- 2) ATTACH LID TO D3230-041 BASKET WEDGE ASSEMBLY. MOVE D2332-041 PROP ASSEMBLY FROM BASKET BASE TO WEDGE ASSEMBLY PER FIGURE 1.
 - 3) LOCATE D3230-041 BASKET WEDGE ASSEMBLY COMPLETE WITH BASKET LID ON THE EXISTING BASKET BASE. TEMPORARILY CLAMP IN PLACE AND CHECK FOR PROPER LATCHING OF THE EXISTING LID WITH THE WEDGE. ADJUST LOCATION OF WEDGE ASSEMBLY TO ENSURE PROPER LATCHING. SHIM AS REQUIRED TO ENSURE PROPER LATCHING.
 - 4) TRANSFER LOCATION OF 1/4" ATTACHMENT HOLES FROM WEDGE TO EXISTING BASE.
 - 5) REMOVE WEDGE AND DRILL Ø0.266" HOLES THROUGH THE EXISTING BASE. DEBURR HOLES.
 - 6) INSTALL WEDGE USING AN4-17A BOLTS, AN960JD416 WASHERS, AND MS21042L4 NUTS PROVIDED (5 PLACES TOTAL). NOTE THAT THE BOLTS IN SOME LOCATIONS MAY HAVE TO BE INSTALLED WITH THE NUTS ON TOP BECAUSE OF CLEARANCE ISSUES.
 - 7) ADJUST WEIGHT AND BALANCE AS FOLLOWS:

INSTALLATION	WEIGHT	LATERAL		LONGITUDINAL	
		ARM	MOMENT	ARM	MOMENT
DSI 9268-011	20 lb	± 63.13 in	± 1263 in-lb	132.25 in	2645 in-lb
BASKET MODIFICATION KIT	9 kg	± 1.60 m	± 14.4 m-kg	3.36 m	30 m-kg

DSI 9268-011 KIT PARTS LIST:







QTY -011	P/N	DESCRIPTION
X	DSI 9268-011	BASKET MODIFICATION KIT
1	D3230-041	BASKET WEDGE ASSEMBLY
1	DSI 9053-011	HINGE CHANGE KIT
5	AN4-17A	BOLT
5	AN960JD416	WASHER
5	MS21042L4	NUT

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.02.02
CERT. NO.: SH96-120
ISSUE NO.: 3

C	UPDATED TO CURRENT DWG STANDARDS; REVISED INSTALLATION STEP #1. CORRECTED TYPO (DSI 9053-011 WAS DSI 9052-011). REASON: REDESIGN OF D3230-041 (REF. NCR#09-010).	MB	09.02.02
B	CHANGE ORIENTATION OF WEDGE	CP	03.11.19
A	NEW ISSUE	CP	03.10.24
REV.	DESCRIPTION	BY	DATE
DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.		DSI 9268	SHEET 1 OF 2
APPROVED		TITLE	SCALE
DE APPR.		BASKET MODIFICATION KIT	NTS
DATE	09.02.02	COPYRIGHT © 2003 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

REFERENCE ONLY

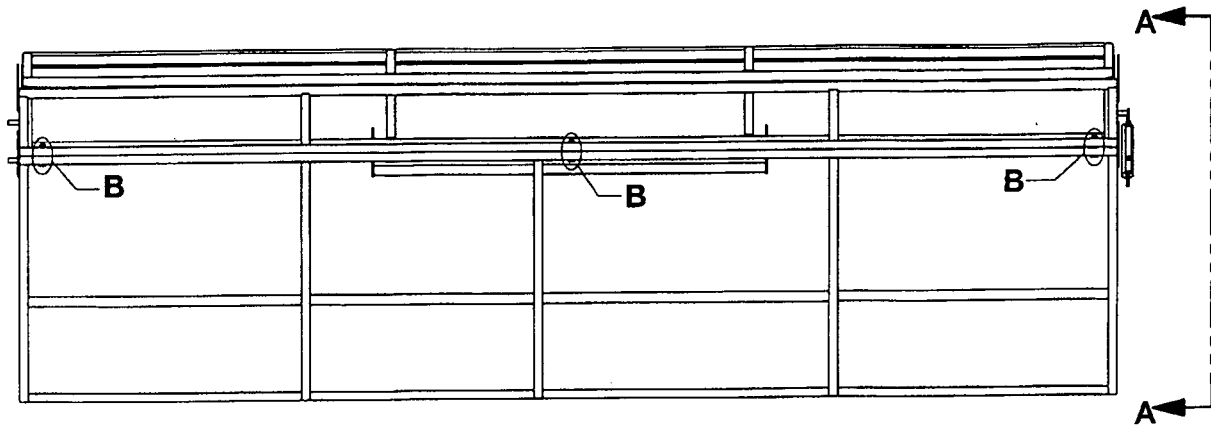
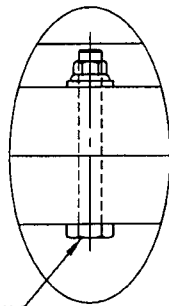
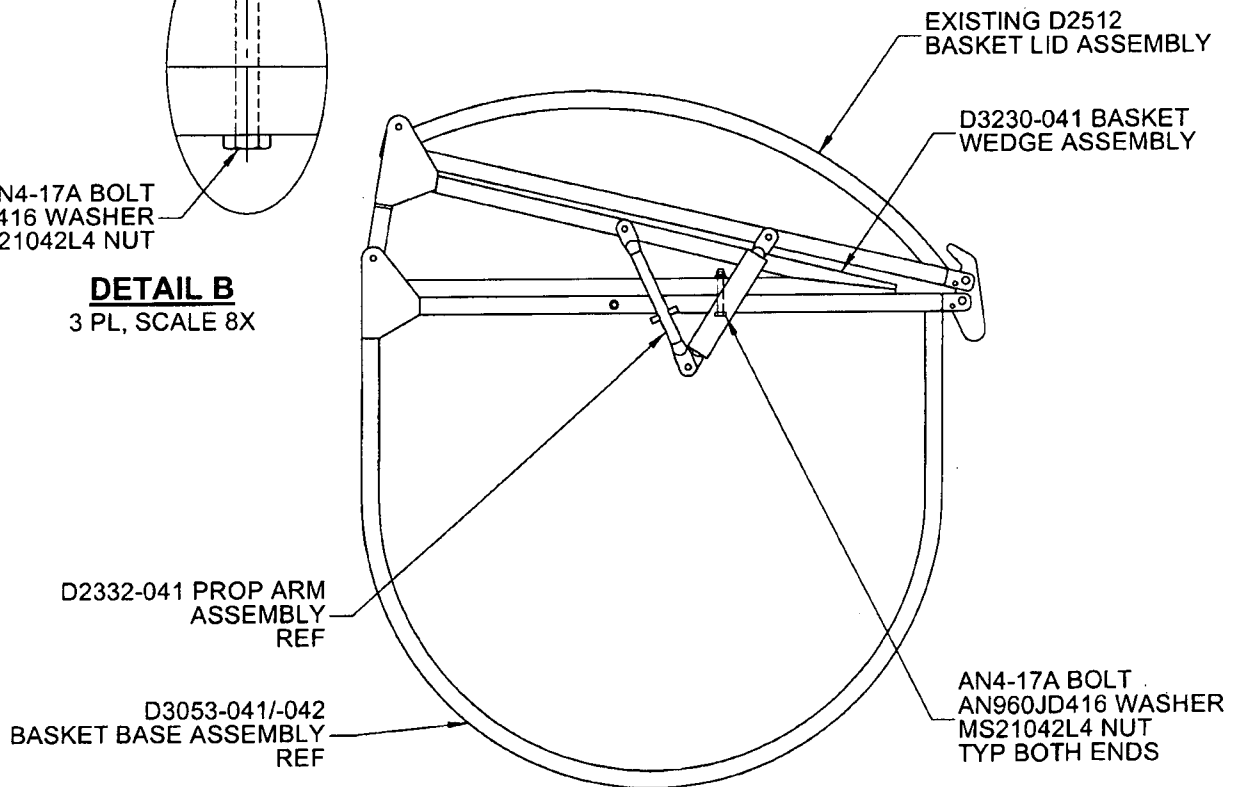


FIGURE 1 - LOOKING OUTBOARD
(MESH NOT SHOWN FOR CLARITY)



AN4-17A BOLT
AN960JD416 WASHER
MS21042L4 NUT

DETAIL B
3 PL, SCALE 8X









VIEW A-A
(MESH NOT SHOWN FOR CLARITY)

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.02.02
CERT. NO.: SH96-120
ISSUE NO.: 3

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.		DSI 9268	SHEET 2 OF 2
APPROVED		TITLE	SCALE
DE APPR.		BASKET MODIFICATION KIT	NTS
DATE	09.02.02	<small>COPYRIGHT © 2003 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	